


P38

B38

3030


Planta

ESC: 1/25

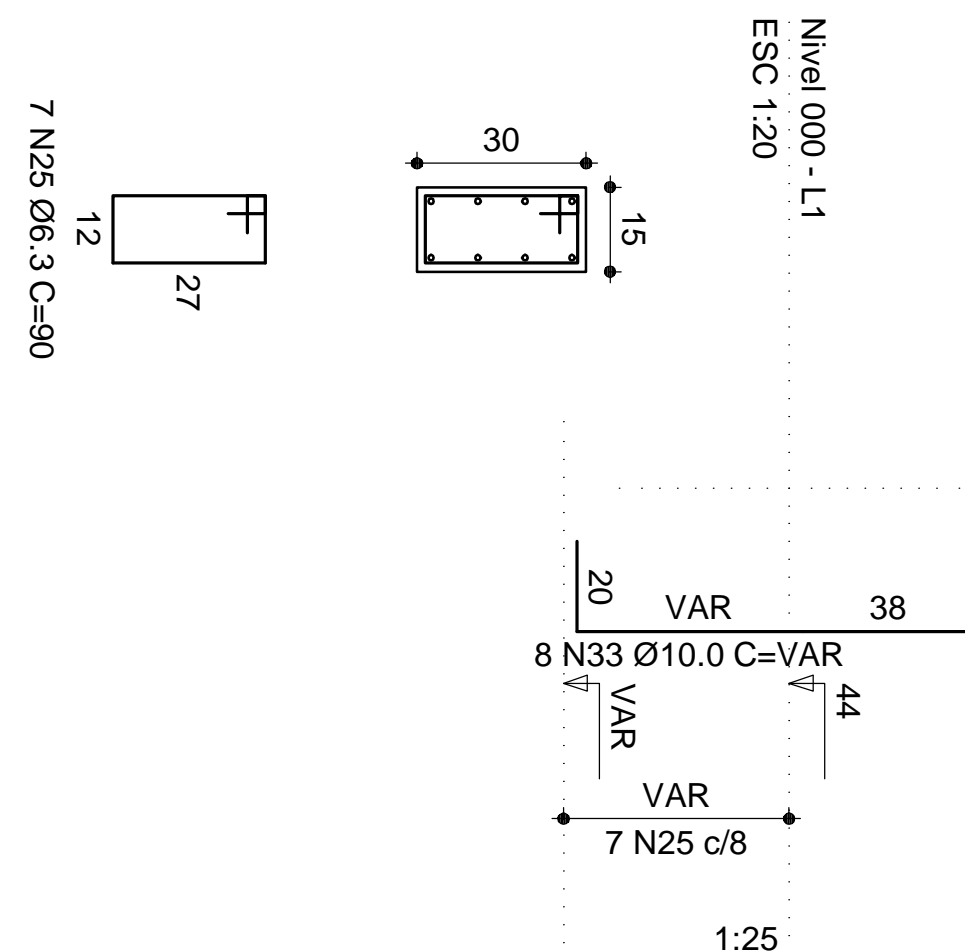

Corte

ESC: 1/25

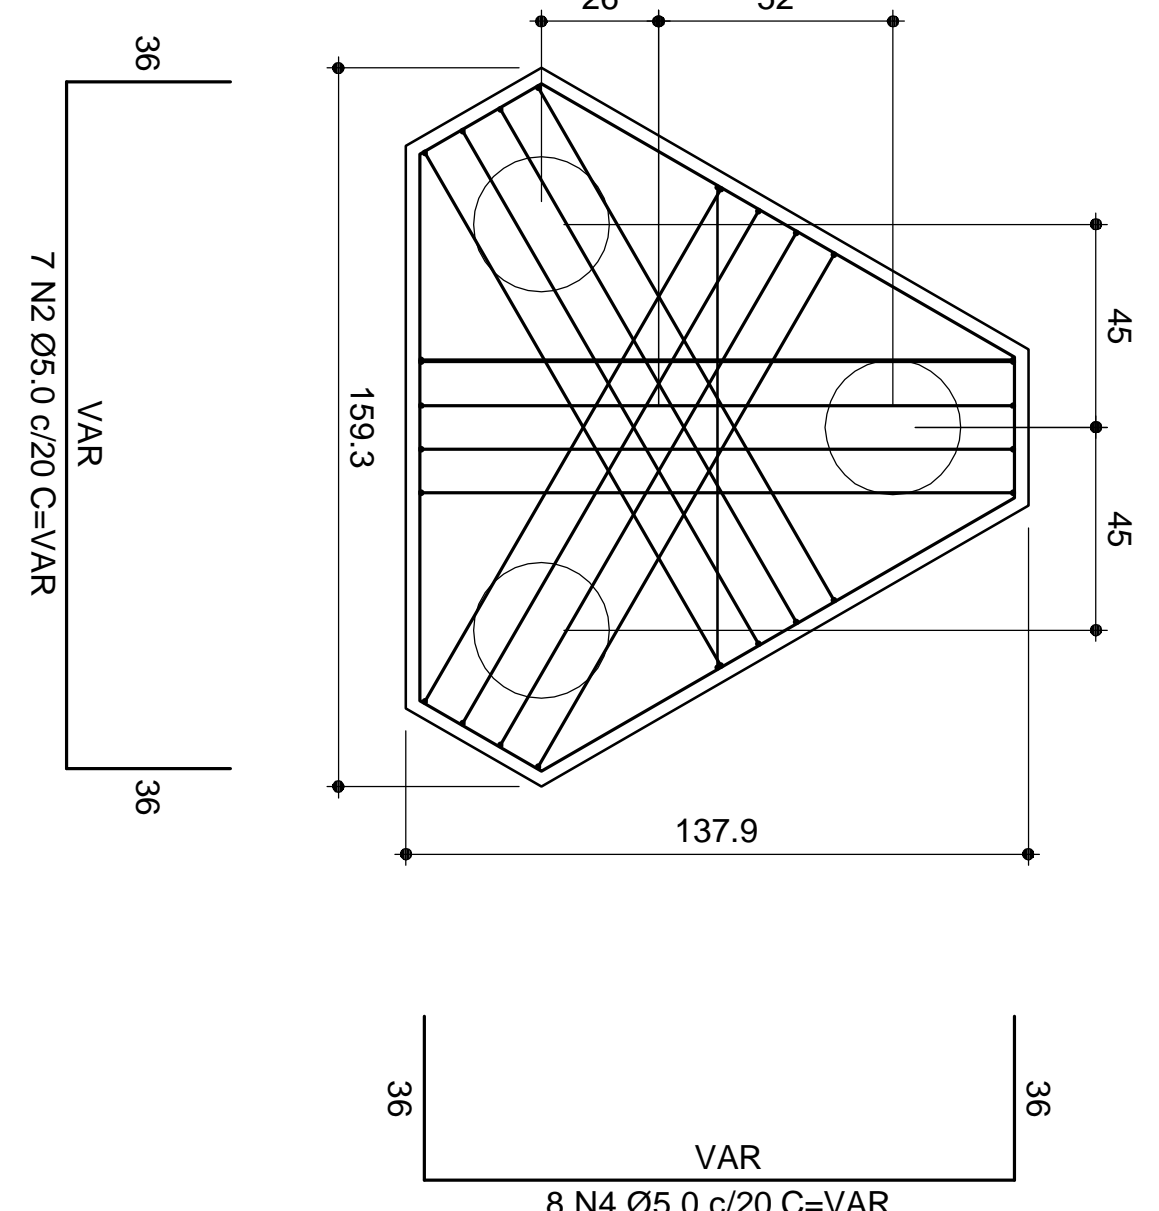

P63


P68

B63-B68

2030


Planta

ESC: 1/25

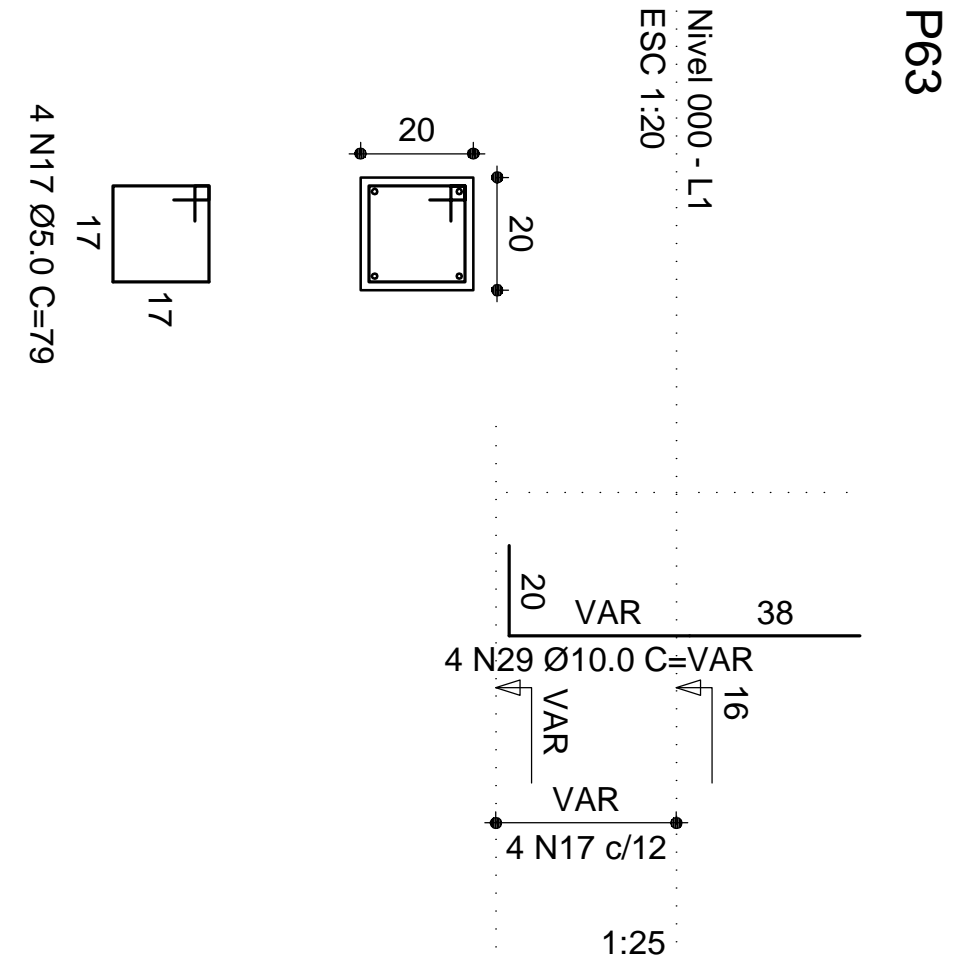

Corte

ESC: 1/25

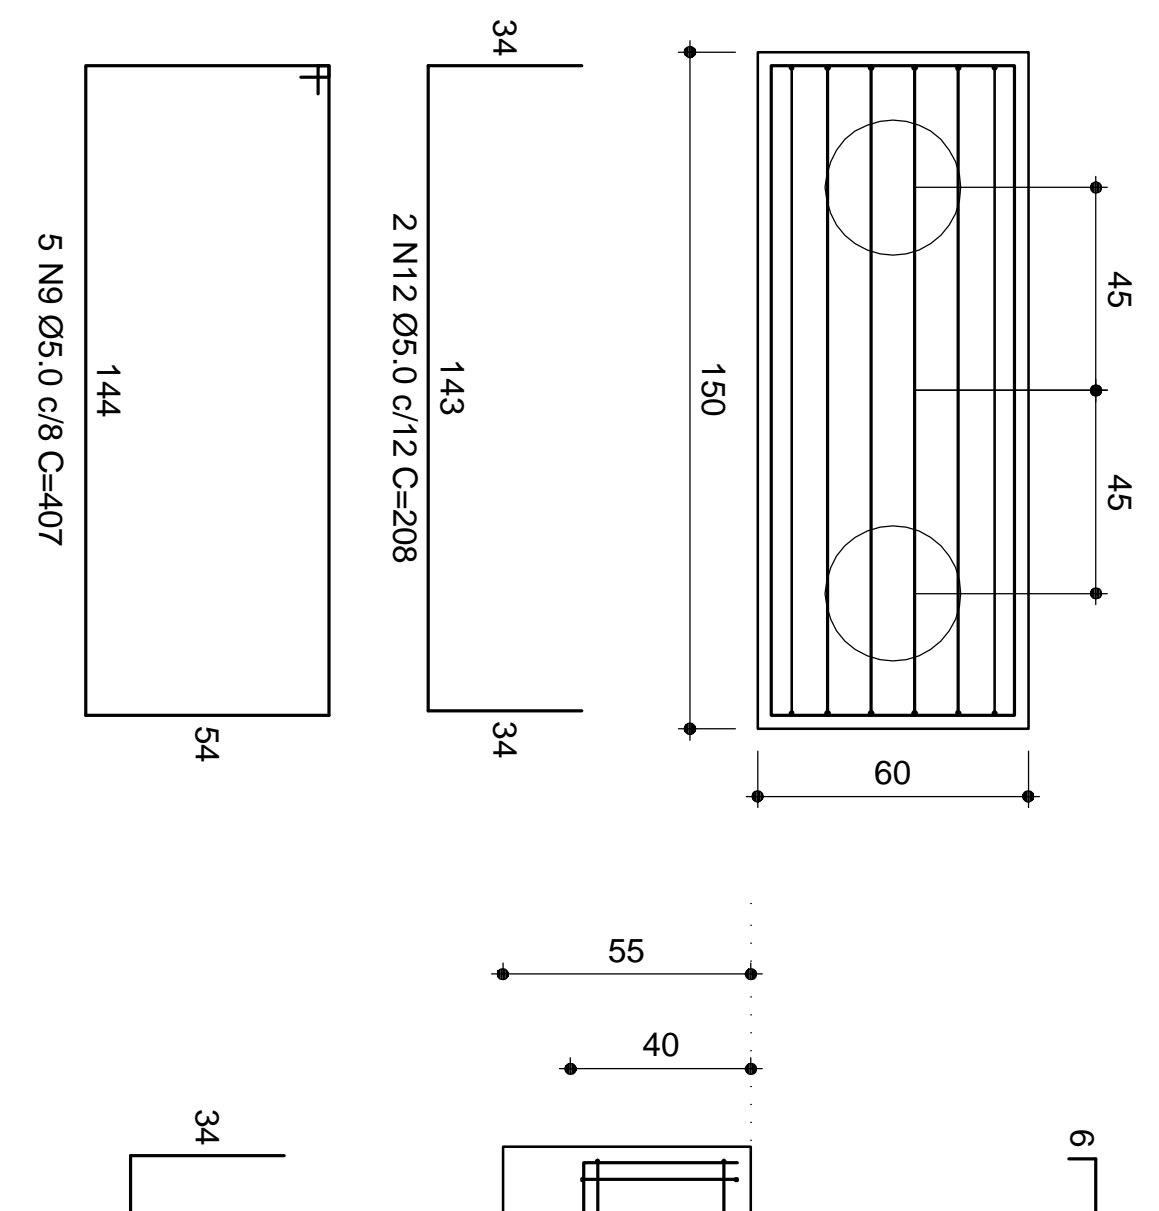

P5=P22

P4=P15=P24=P31=P45=P48=P66=P57=P64=P65

=P66

P23=P39

P6

P9=P46













B4=B6-B6=B9=B15=B22=B24=B29=B31=B39=B45

=B46-B48-B56-B57-B64-B55-B66

=B67

Planta

ESC: 1/25

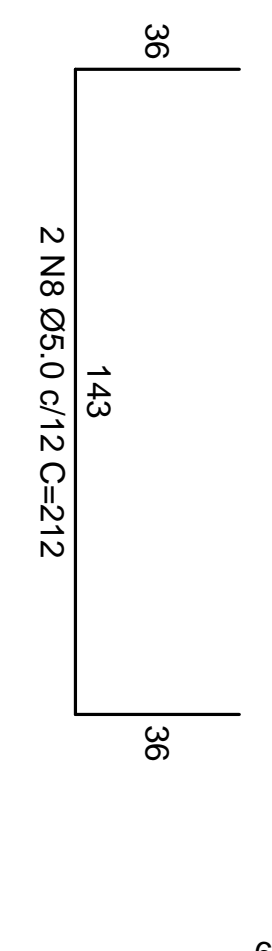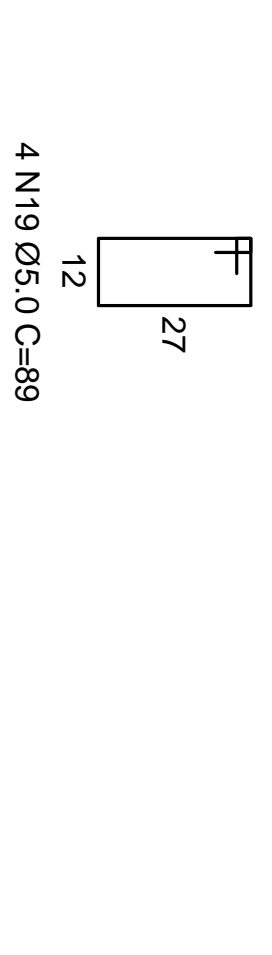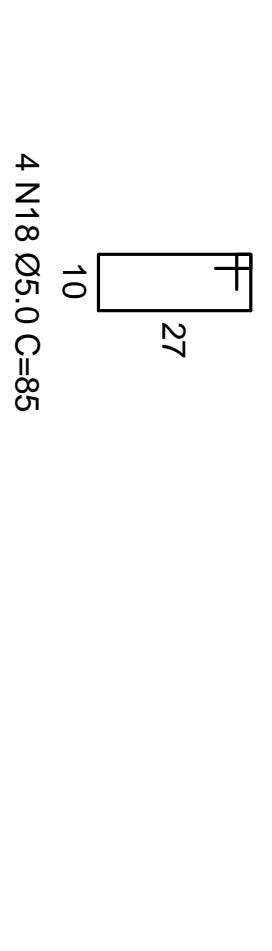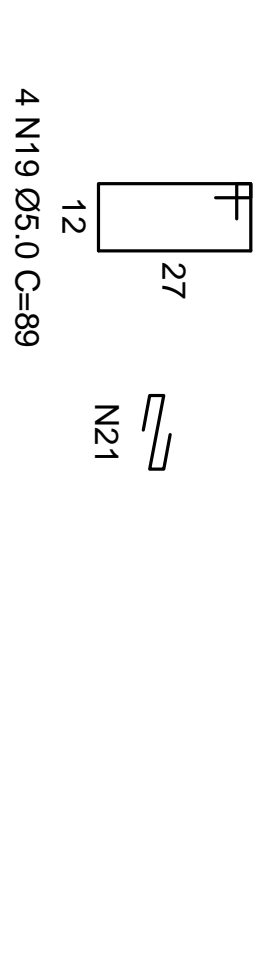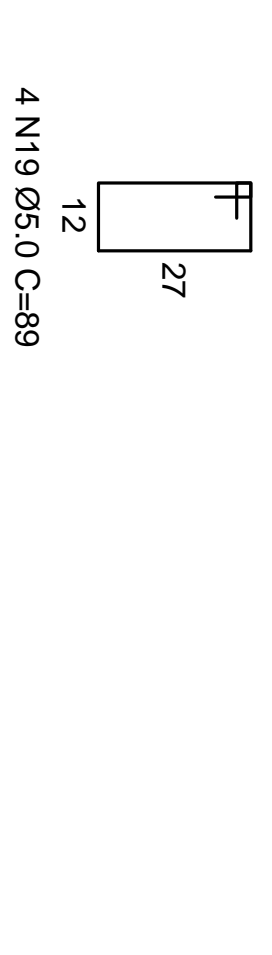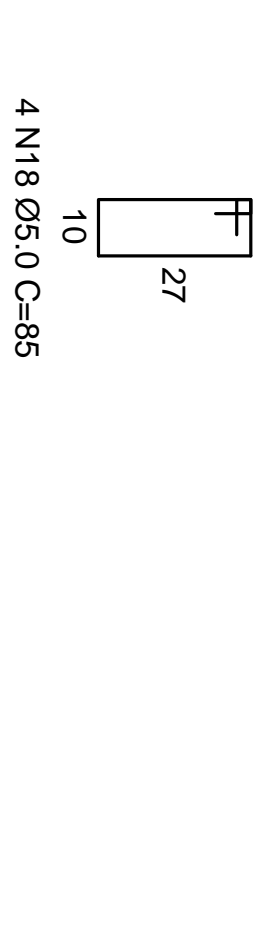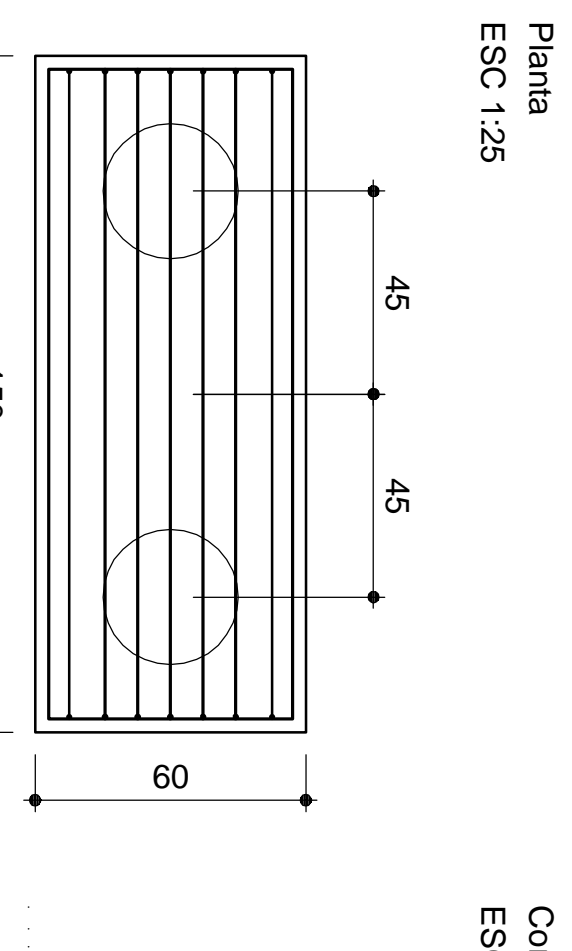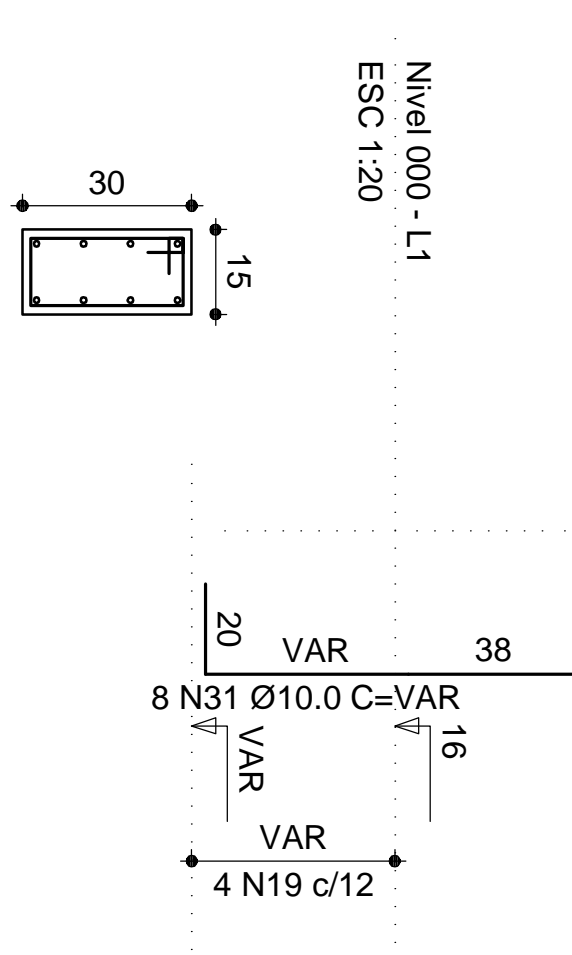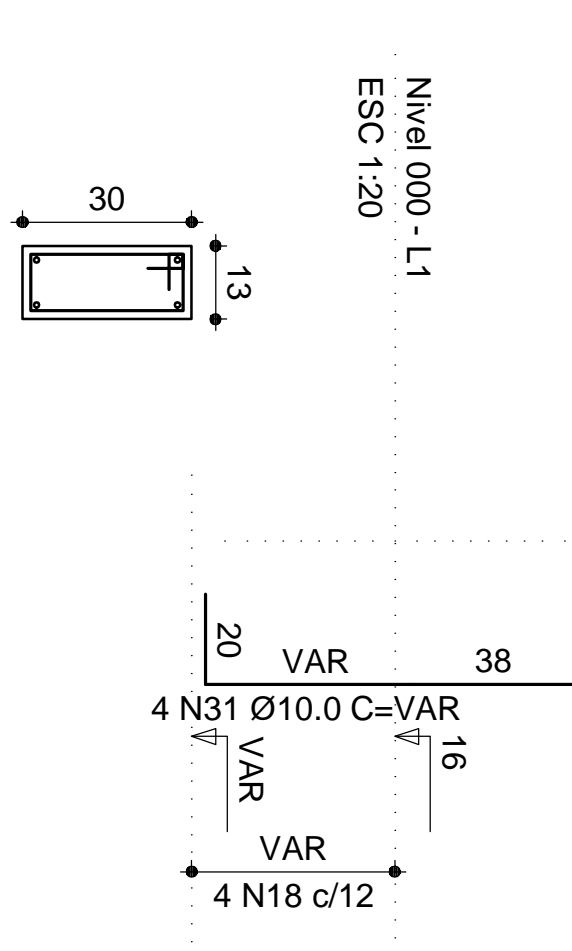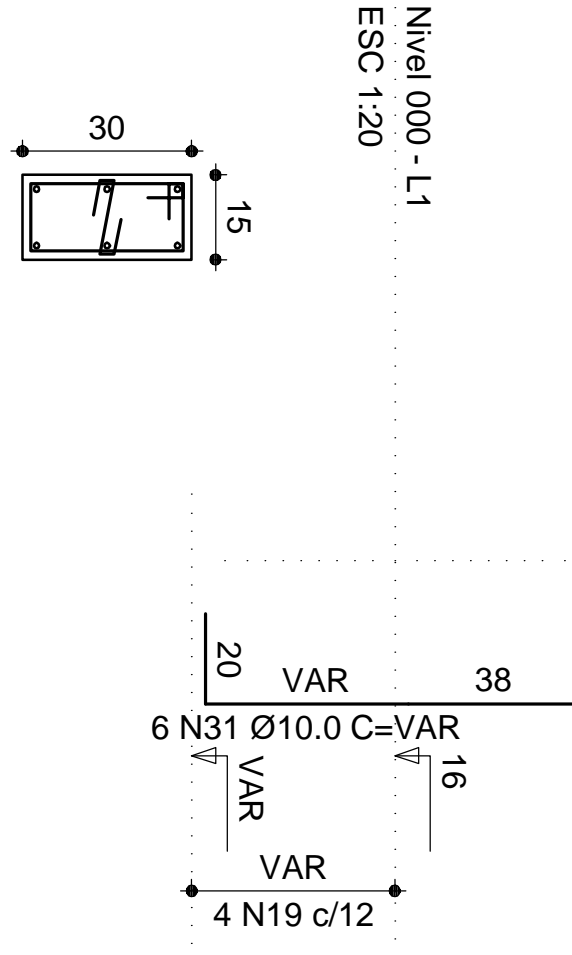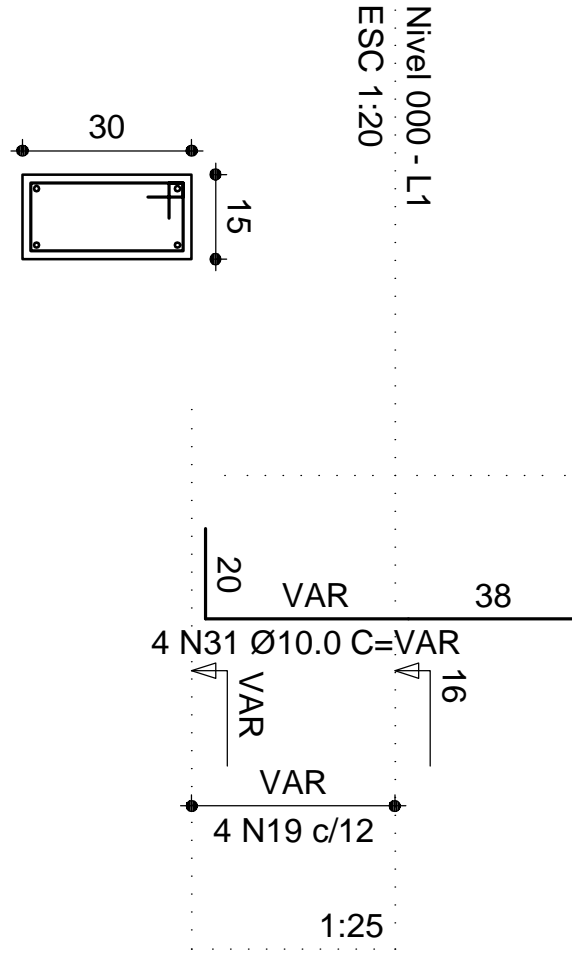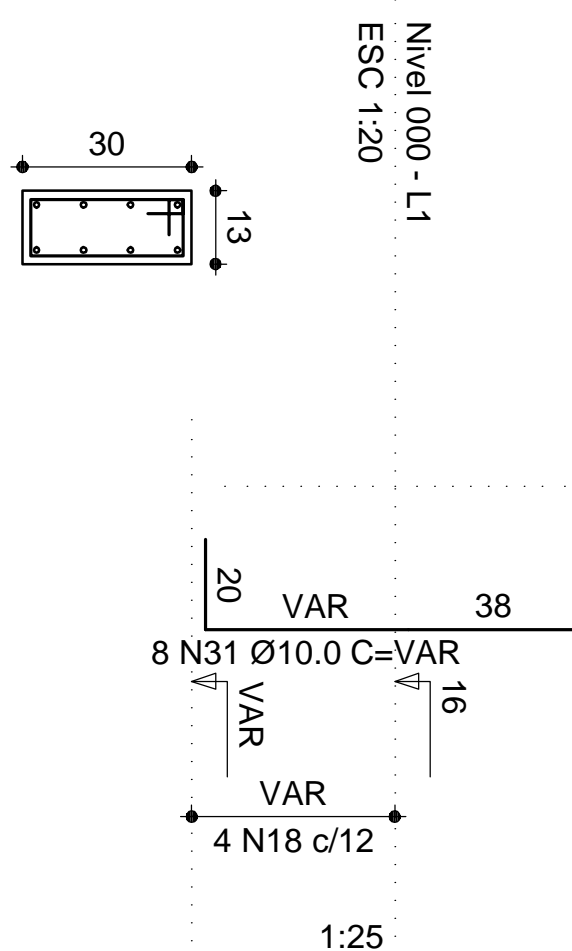

P35












P8=P30=P44=P50=P54=P58=P61

B8=B30-B35-B44-B50-B54-B56-B61

1030

Planta

ESC: 1/25

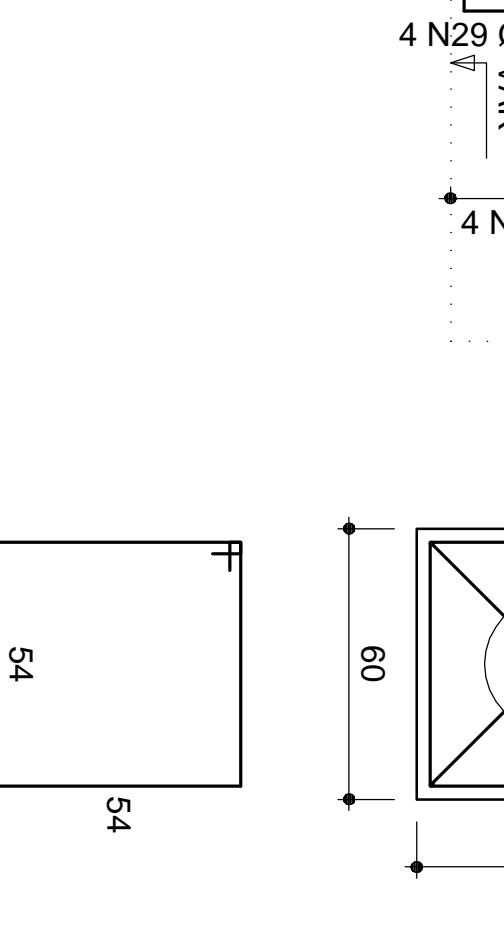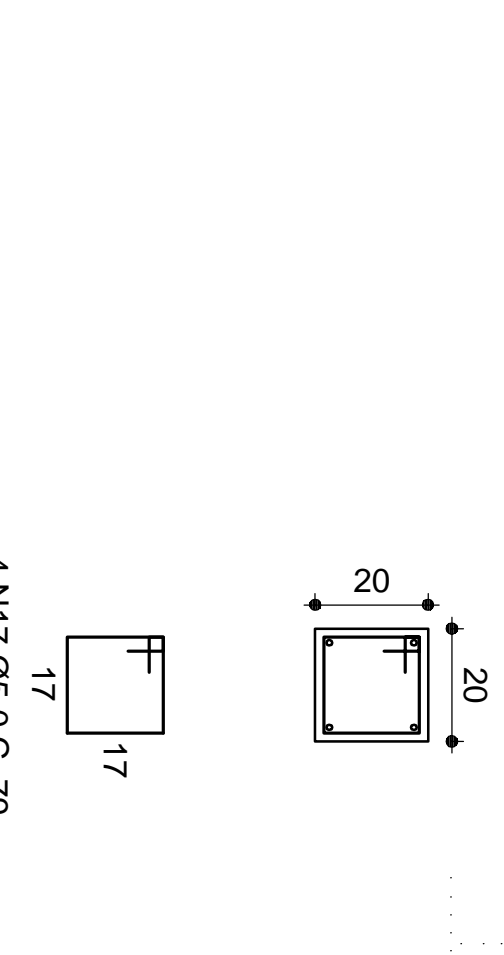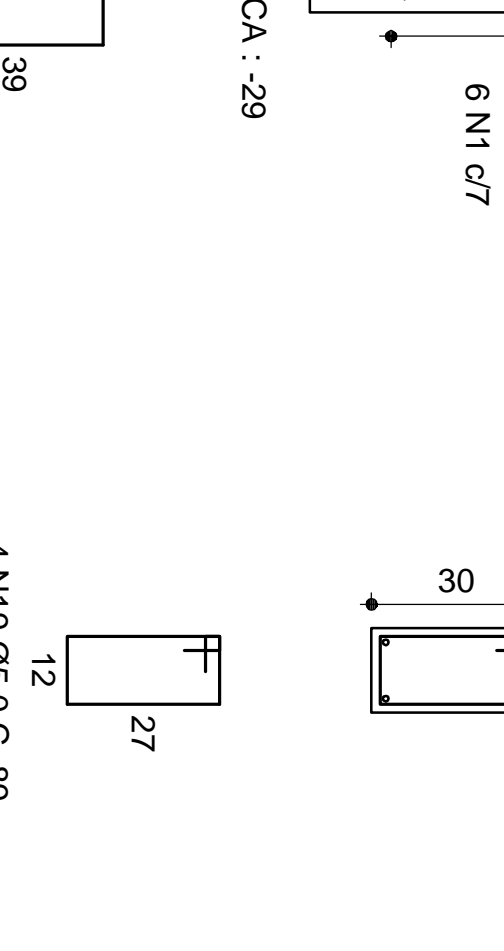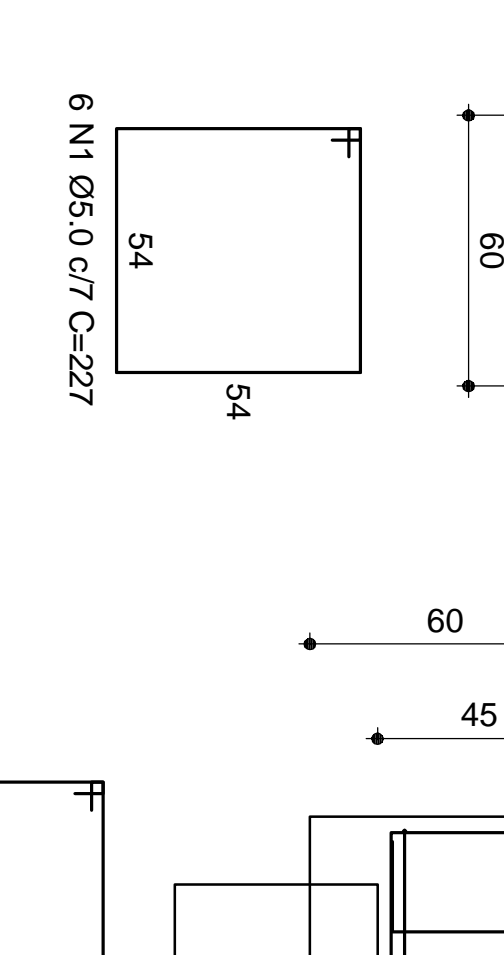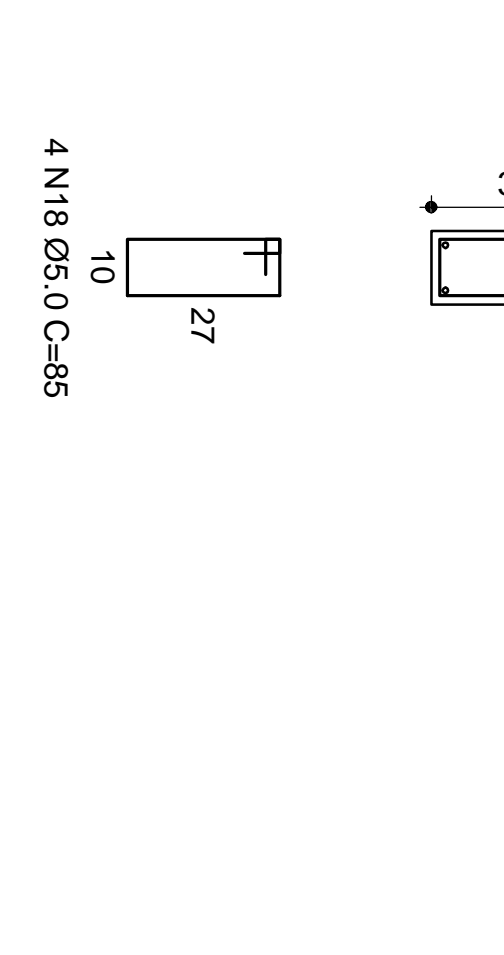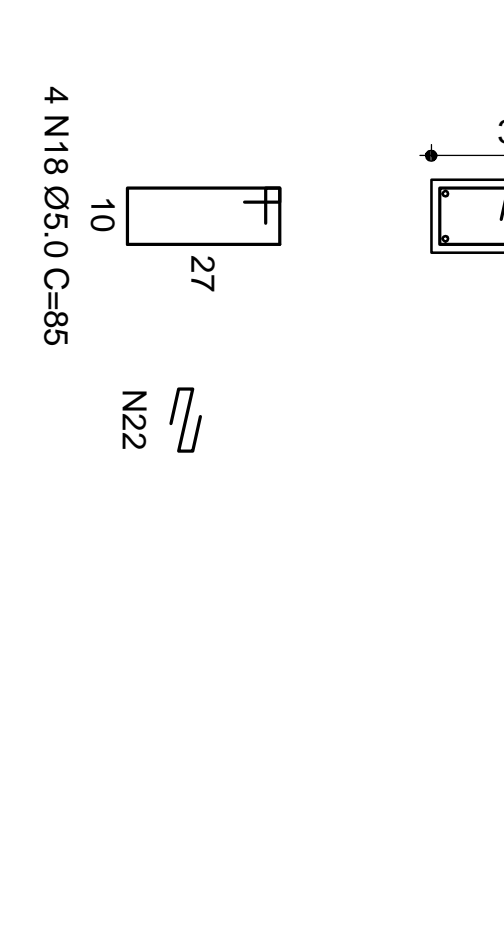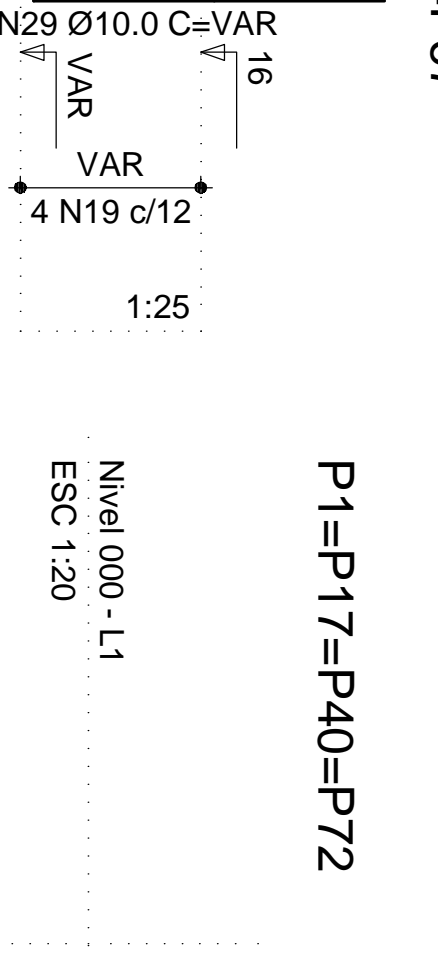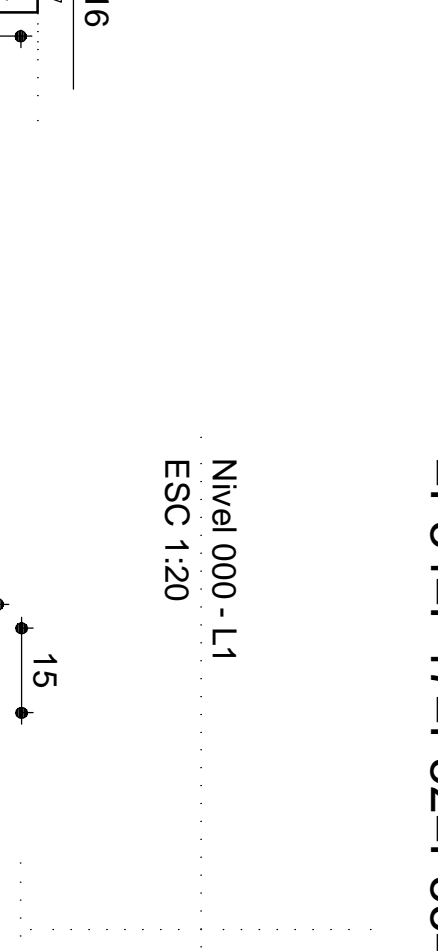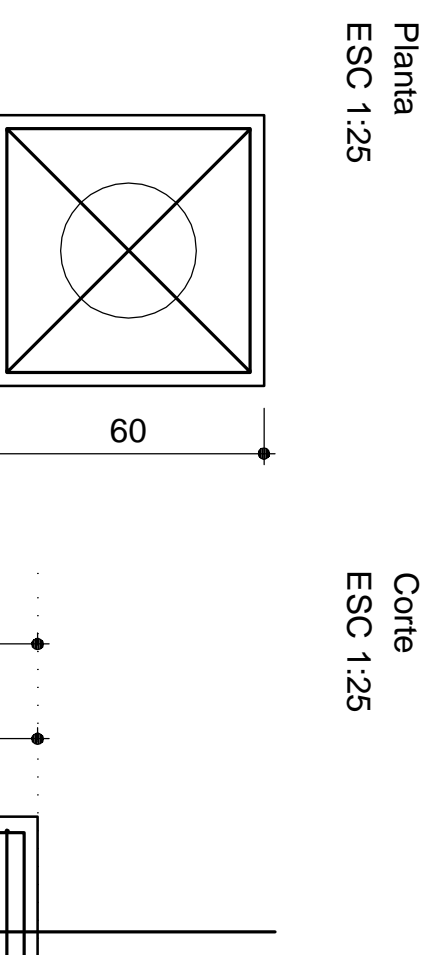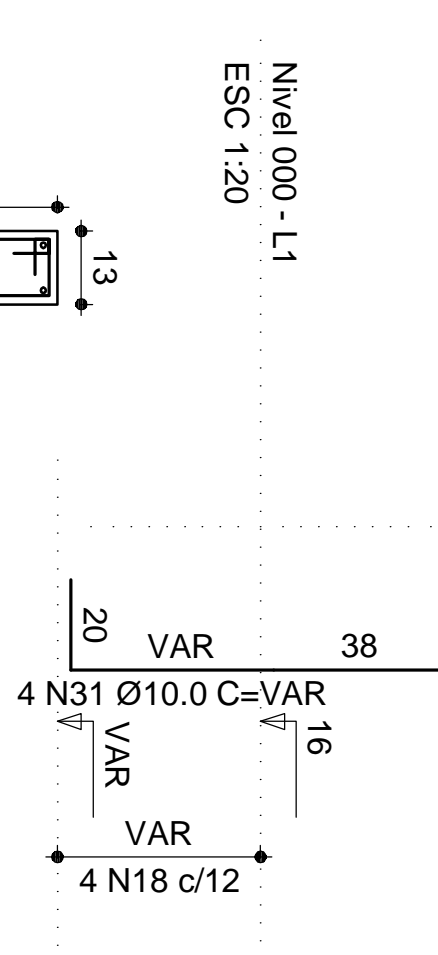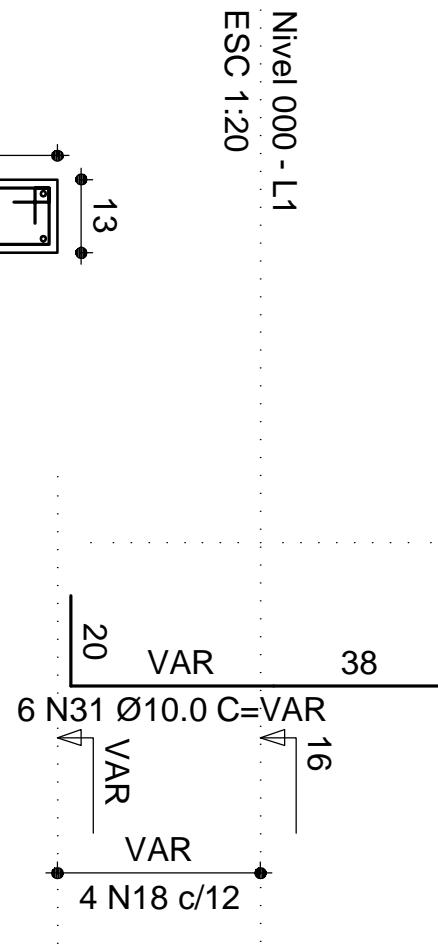

P12=P18-P28-P41=P42

P7

P73=P74=P75=P76=P77

B7-B12-B18-B28-B41-B42-B73-B74-B75-B76













P20=P26=P27=P36=P37=P43

P2=P10=P21=P49=P51=P53=P59=P60=P68=P72-B16-B20-B21-B26-B27-B36-B37-B43-B49

=P71

Planta

ESC: 1/25

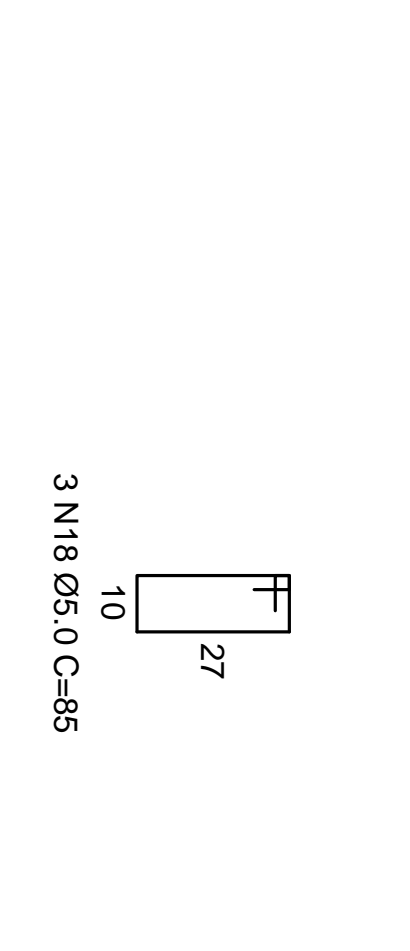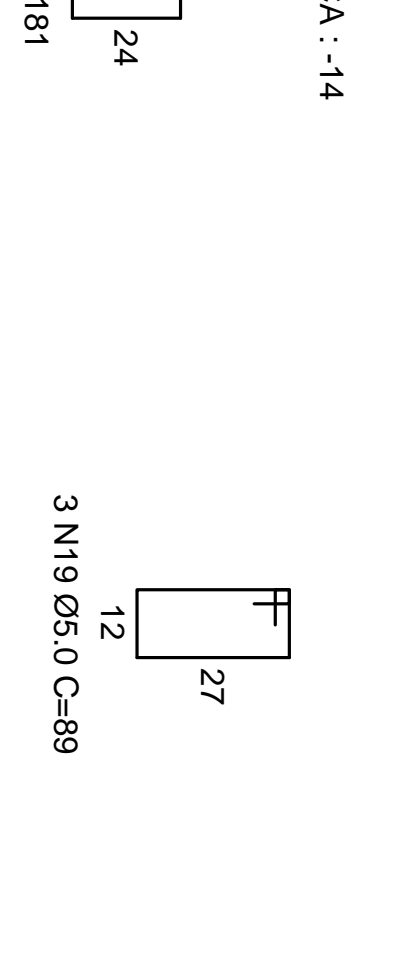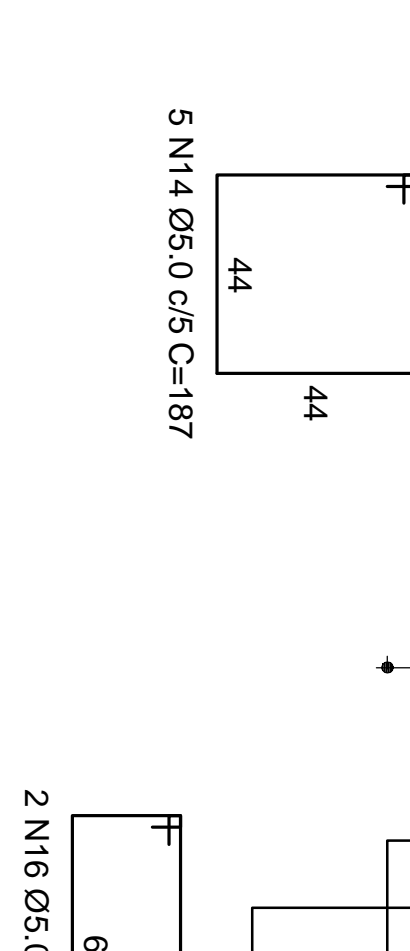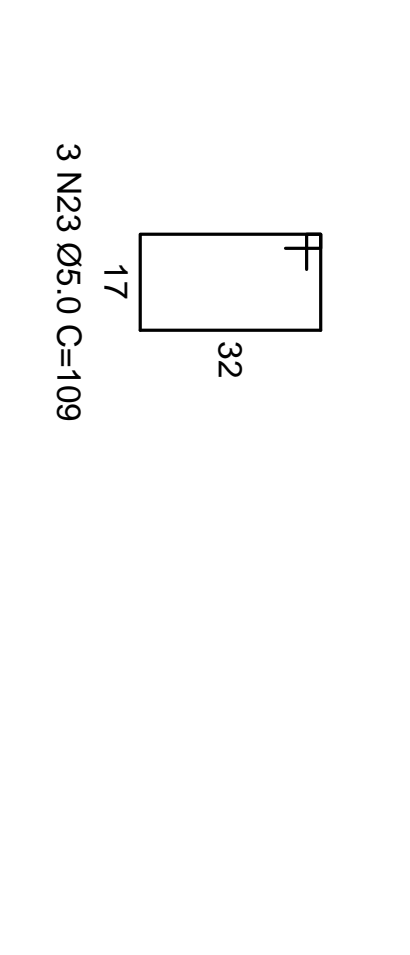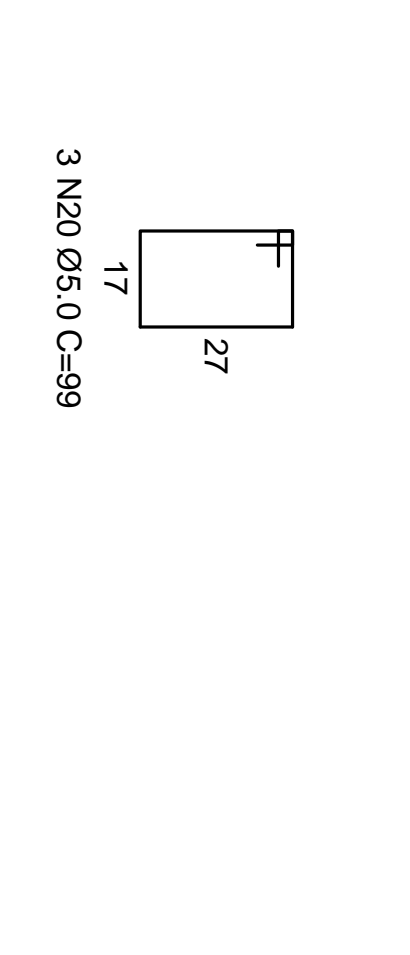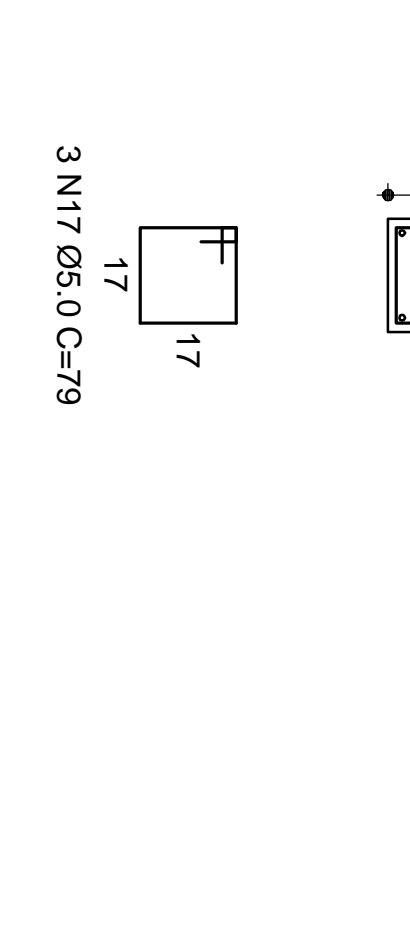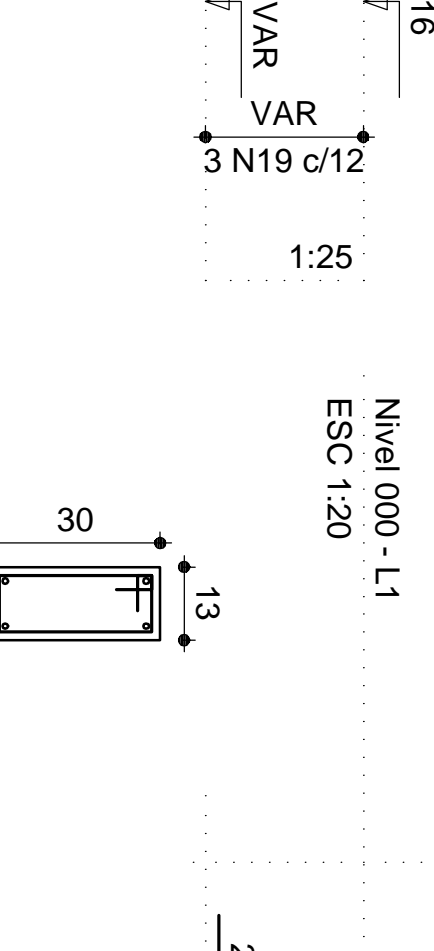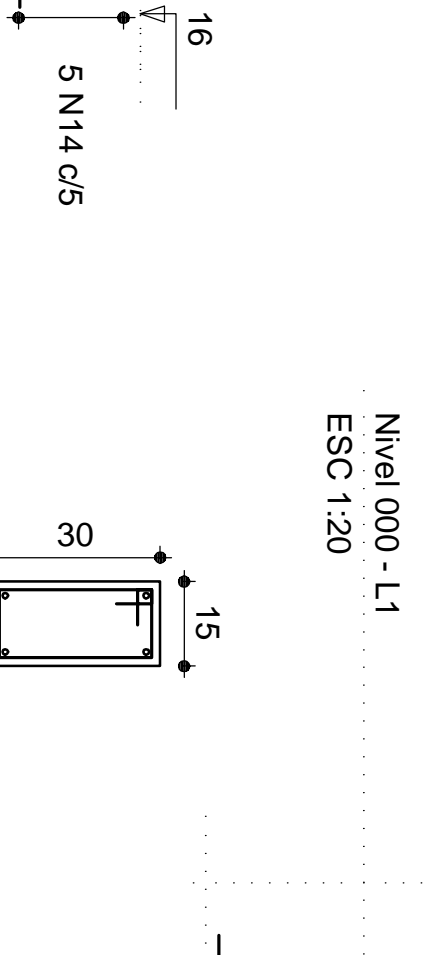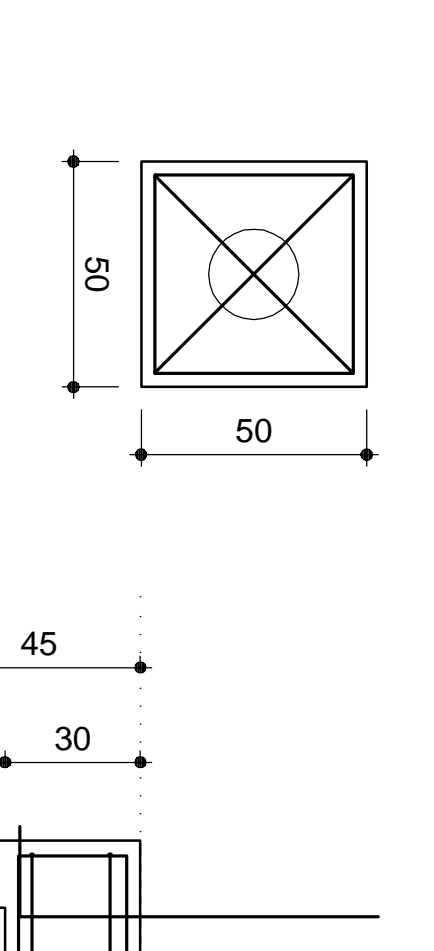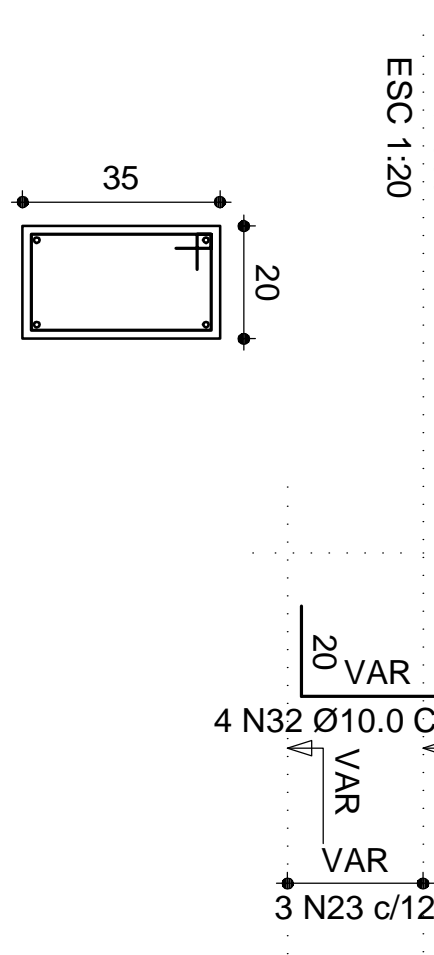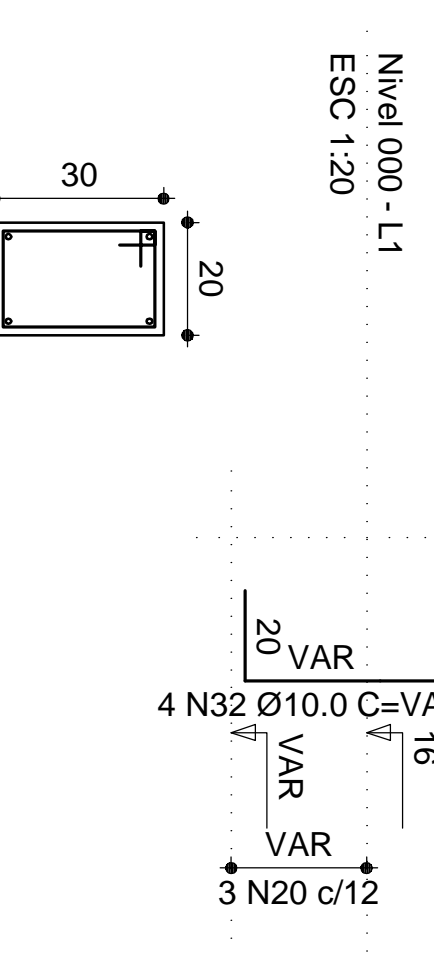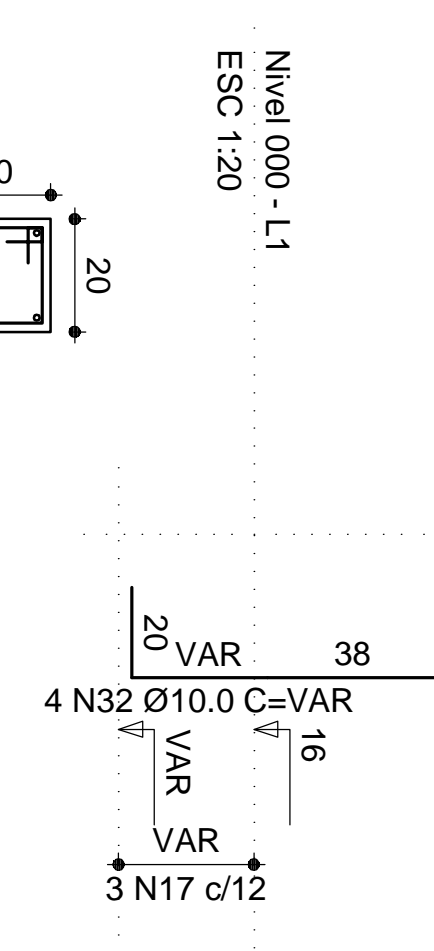

RELACÃO DO AÇO										
20x63x3		E338		8x84		Q		C TOTAL		
11x63x7		E474		11x63x7		Q		C TOTAL		
16x63x7		E474		16x63x7		Q		C TOTAL		
20x63x7		E474		20x63x7		Q		C TOTAL		
ACO	N	DIAM	O	UNF	C TOTAL	Q	C TOTAL	Q	C TOTAL	
CA60	2	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	3	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	4	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	5	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	6	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	7	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	8	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	9	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	10	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	11	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	12	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	13	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	14	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	15	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	16	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	17	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	18	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	19	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	20	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	21	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	22	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	23	5,0	142	VAR	2,5	2,5	2,5	2,5	2,5	
	24	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	25	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	26	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	27	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	28	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	29	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	30	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	31	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	32	6,3	40	230	VAR	2,5	2,5	2,5	2,5	
	33	10,0	142	VAR	6,25	56,75	56,75	56,75	56,75	56,75